



Lic. No. AZ0003

14 July 2020

Ms. Debbie Tribioli The Oasis at Anozira c/o Kinney Management Services 6303 South Rural Road Tempe, Arizona 85283


Ref: Oasis Lake, May 2020

Dear Ms. Tribioli:

The following report summarizes water quality data collected for Oasis Lake on 06 May 2020. Similar data have been reported each month and are used in this report to generate the graphs that are used for tracking changes in water quality. The report includes field data sheets summarizing weekly lake and mechanical system conditions during the month.

#### **Chemical and Physical Composition**

**Temperature, Oxygen, and pH**: Water temperature increased to 25.3 C (77 F) and the dissolved oxygen concentration was at 83 percent saturation (6.8 mg/L). Operation of the floating fountains, as well as the trial nanobubble oxygenation system, helped maintain dissolved oxygen at a level that was satisfactory for the fishery.

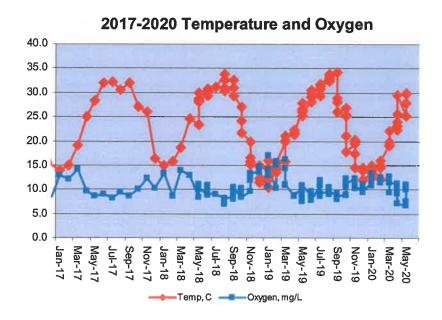


The table below shows the USEPA criteria for dissolved oxygen in warm water fisheries.

| Criterion     | Early life stages | Other life stages |
|---------------|-------------------|-------------------|
| Daily mean    | >6.0              | >4.0              |
| Daily minimum | >5.0              | >3.0              |

Water temperature tolerance varies among fish species. However, the maximum weekly temperature tolerance of most common urban lake fish species is 32 to 35 C.


**Turbidity**: The turbidity of the lake water decreased significantly to 6.4 NTU. Water turbidity is impacted by algae density and dissolved and particulate matter in the water, including storm water runoff and dye that is periodically added for algae and weed management. As turbidity increases, clarity decreases. The trend shows an end to consistent increases over the last four months.

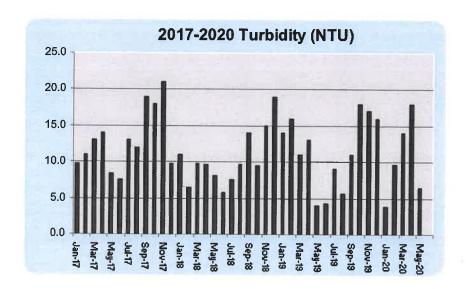

**pH:** The lake water pH varied, as typical, from 8.3 to 8.8 SU during the month. Water pH is influenced by the chemical makeup of the water and the amount of algae in the lake. In a very simplified explanation for the role of algae, carbonic acid in the water is formed from dissolution of carbon dioxide. Carbonic acid tends to make the water more acidic and pH

decreases. However, algae utilize carbon dioxide during photosynthesis during daylight, making less carbon dioxide available to form carbonic acid, and pH increases. The more algae present, the greater the increase in pH that usually occurs. Data indicate that pH was similar to measurements last month. pH changes may also result from differences in SRP canal feed water composition.


High pH can be problematic in terms of toxicity if high concentrations of ammonia are present in the water. Ammonia is in equilibrium between two forms;

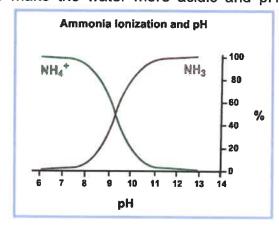


ammonium ion and ammonia gas. At pH concentrations above 9.0 SU and a water temperature increases, ammonia converts to the gas which is toxic to many aquatic organisms. At the measured water temperatures and pH values, ammonia toxicity would not be expected. No signs of fish stress were observed.

**Nutrients:** Nitrogen and phosphorus are the primary nutrients that stimulate algae and submerged plant growth. Phosphorus is typically the nutrient that dictates how much plant growth can be sustained in a lake. Usually if the total phosphorus concentration is below 0.030 mg/L, low levels of suspended algae occur. A nitrogen concentration of about 10 to 15 times the phosphorus (0.30–0.45 mg/L) is typically needed to support algal growth.


The phosphorus concentration decreased to 0.057 mg/L as P. The total nitrogen concentration was stable at 1.48 mg/L as N. Nitrate, immediately available to algal cells, was at a concentration of 0.08 mg/L. A decrease in nutrient concentrations was evident and a corresponding decrease in algae growth would be expected and occurred.

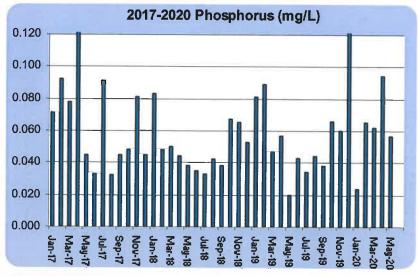

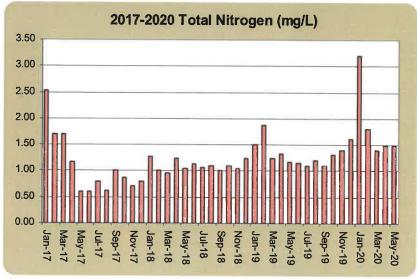


#### **Biological Composition**


**Phytoplankton (algae)**: The amount and types of algae in a lake dictate the aesthetic and operational quality of the water. Algae density affects the clarity and color of the water, two very important aesthetic criteria. The species composition dictates the form of growth observed; floating mats, suspended cells, stringy attached filaments, etc. It also impacts the choice, frequency, and dosage of herbicides used for water quality management.

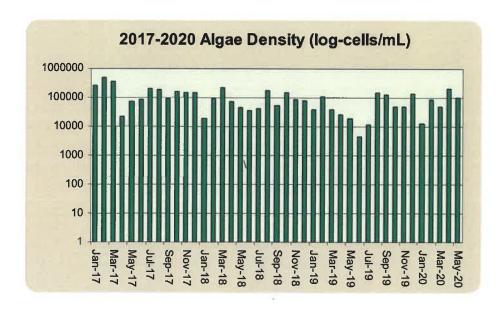

As predicted, the total algae density in the lake decreased to 9.65 X 10<sup>4</sup> cells per mL, a density now considered moderate for an urban reservoir in metro-Phoenix. Often-problematic bluegreen (Cyanophyta) algae (*Oscillatoria*, *Spirulina*) comprised about 30 percent of the total assemblage. The dominant alga was *Chlorella*, a green unicell.



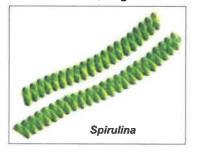

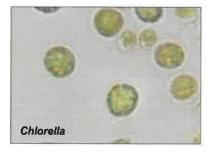


Golden algae was intermittently detected at the beginning of the month, but was absent thereafter. A few dead fish were recovered. The golden alga (*P. parvum*), produces toxins that rupture unprotected cells. The toxin release is believed to benefit golden algae by killing other species of algae, thereby making resources (nutrients) more available to the golden algae population. Unfortunately, the cells of fish gills are also unprotected because that is where oxygen absorption occurs. Thus, the toxin also results in asphyxiation of fish. Susceptibility to the toxin varies amongst fish species.



Midge flies: Midge flies are common inhabitants of most lakes. Adult females lay hundreds of eggs on the water surface. The eggs settle to the lake bottom and hatch in a few days. Larvae develop and grow in the superficial sediments over a three to four week period. In about 30 days the insect larvae become pupae, rise in the water column, and emerge as adult flies. The life cycle is shown diagrammatically below. Adults tend to swarm at dusk and dawn and become a nuisance. They fly into residents' eyes and mouths, congregate under eaves of houses, and leave a sticky messy residue when they die. Management techniques may include stocking of bottom-feeding fishes to consume the larvae and/or application of bacterial or chemical larvicides. Because fish have not been stocked for three years or more, a maintenance stocking proposal has been presented to the Board.





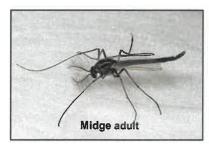

Few adult midge flies were detected during the month.

**Fishery:** Approximately 50 common carp were lost at the beginning of the month, likely the result of golden algae toxin. No further fish losses occurred following the single episode and after negative tests were received for presence of the toxic alga.

**Waterfowl:** Ducks and geese can be a beautiful sight on a small urban pond or lake. They seem to make the lake look more like a natural lake than an artificial reservoir. They are fascinating creatures. However, when ducks and geese become too numerous, several lake management and aesthetic problems can develop. These problems are listed below.

- Bird wastes are unattractive and cause slippery conditions.
- Cleaning waste from sidewalks and turf is an additional maintenance item.
- Geese and other waterfowl can become aggressive toward humans.
- Waterfowl can damage turf areas.
- Waterfowl add nitrogen and phosphorus to the water.
- Bird wastes contain bacteria that are a health risk to humans and pets.
- Diving birds consume fish that are stocked in the lack for management purposes.





Arizona Game and Fish Department has developed criteria for waterfowl on small urban lakes (see table). Based on the Arizona Game & Fish Department scale, the lake condition in terms of waterfowl has remained in the "good to excellent" category.

Problematic Canada geese were observed during the month. Canada geese can destroy turf and, along with other birds, contribute fecal matter to the common areas and water. Cormorants, diving birds that feed on small fish, were not seen. See photos above.

| Ranking   | Waterfowl Density |
|-----------|-------------------|
| Excellent | <3/acre           |
| Good      | 3-4/acre          |
| Fair      | 5-6/acre          |
| Poor      | >6/acre           |

#### **Bacteria**

In terms of public health protection, the *E. coli* bacteria concentration was relatively low (15 per 100 mL) and met incidental or partial body contact (PBC) and full body contact (FBC) recreational standards. The table below displays the numeric standards from the State Water Quality Standards (R18-11-109 A; 2016).

| Designated use                          | E. coli single sample<br>max. no/100 mL |
|---|---|
| Full body contact (swimming)            | 235                                     |
| Partial body contact (boating, fishing) | 575                                     |

#### **Mechanical Systems and Field Observations**

Weekly field inspection forms are attached to this report. In-lake and entry fountains and nanobubble aeration systems operated during the month. Issues with some of the nanobubble discharge lines were found and appeared to be possible associated with leaks in the irrigation distribution system. Oxygen generator and pump appeared to be operating properly.

Endothall and peroxide-based algaecide applications were made, as needed, to the three entry fountains to reduce algae growth on the wetted rock surfaces.

#### Lake Report Card

The water quality data are summarized on the attached Oasis Lake Report Card. Each salient parameter has been qualitatively evaluated and then assigned a numeric value for quantitative comparison and tracking purposes. The May score increased to 44 and was classified as "excellent". The improved score occurred as a result of the algal density decrease, improved clarity, and nutrient reduction.

Report card scores for the past three years have been graphically summarized below. Polynomial regression analysis (black line) still indicates a somewhat cyclic pattern. Linear regression analysis (red line) indicates and overall increasing trend in score.



Respectfully,

AQUATIC CONSULTING & TESTING, INC.

Frederick A. Amalfi, Ph.D., C.L.M.

**Laboratory Director** 







#### FIELD INSPECTION FORMS



**PESTICIDE APPLICATION DOCUMENTS** 

# OASIS LAKE REPORT CARD

DATE OF EVALUATION:

PREVIOUS EVALUATION:

CONDITION EXCELLENT May-20

SCORE

40

4

SCORE

CONDITION EXCELLENT

Apr-20

3 pts

2 pts FAIR

1 pt

POOR

SCORE

3

>20

11-20

G009

EXCELLENT

RATIONALE

RESUL.

6.4 6.8

Dissolved oxygen (mg/L)

Furbidity (NTU) CONDITION

4 pts

5-10

\$

>2.0

N

<4.0

1.1-2.0

0.5-1.0

<0.5

algae and macrophyte growth

1.48

algae and macrophyte growth

aesthetics

 $9.65 \times 10^4$ 

0.057

Phosphorus, total (mg/L)

Nitrogen, total (mg/L)

Algae density (no./mL)

Algae form (dominant)

5.6-6.9

>7.0

aquatic life, sediment nutrient

aesthetics

release, odors

4.0-5.5

3

>0.10

0.06-0.10

>5 x 10<sup>5</sup>

က က

> floating mats blue-greens;

common  $1 \times 10^5 - 5 \times 10^6$ blue-greens;

floating mats

greens; no floating mats

aesthetics, treatability

Green unicells

5x104 - 9x104 diatoms; no

 $<5 \times 10^4$ <0.03

0.03-0.05

4

4 3 4

>20% no floating mats

×9.0 11-20%

8.6-9.0 81-125

8.0-8.5

6.5-8.0

swimming, fishery, ammonia

8 9 15

E. coli bacteria (#/100 mL) avg.

V

Macrophytes (% cover)

pH (SU) avg.

aesthetics, boating

21-80

<20

public health protection

<10%

none

significant >125

nuisances nuisances moderate 6-10

nuisances

no nuisances

quality of life

no nuisances

2-2

۲ ۲

nutrient and bacteria loading

N

Waterfowl (no. per acre)

Midge flies

minor

4

3

7

before dawn; fish piping

fish piping common; fish kills common occasional fish

piping, gulping; no fish kills

no fish piping; no fish kills

recreation, aesthetics

normal

Fishery

some fish

4

shore covered with crusts or most of lake patches of salt deposits and numerous Kills

4

scnms

algae scums

deposits and

scnms

some white

no evidence of

salt crusts or algal scums

aesthetics

limited edge growths

Shoreline/banks

Fair

Good 36-41

42-48

SCORING KEY:

30-35

30

## Definitions: Ratings

Excellent: Lake aesthetic and operational conditions above level of expectation.

Good: Lake aesthetic and operational conditions at le level of expectation.

Fair: Lake aesthetic and operational conditions slightly below level of expectation.

Poor: Lake aesthetic and operational conditions considerably below level of expectation.

## Definitions: Terms

pH: -log hydrogen ion conc.; amount of acid in the water identified on scale 1-14; 1 being most acid, 7 neutral, and 14 being most caustic. N/A: not applicable; insufficient data or too early in development of lake (an arbitrary 3 rating is provided for these items). Macrophyte: Large plant, observable without the aid of a microscope, that may be floating, submerged or emergent. Midge: Small, flying, non-biting "gnat-like" insect whose larval stage exists in the lake sediments (bloodworm) Phytoplankton (algae): Microscopic plant fraction of the plankton community.

Piping: Act of fish coming to surface of water and capturing a bubble of air in their mouth; a sign of low oxygen concentrations. Plankton: Organisms of relatively small size that have relatively small powers of locomotion or that drift in the water. Furbidity: Degree to which particles and color in the water scatter light; the "cloudiness" of the water.



#### AQUATIC CONSULTING & TESTING, INC.

1525 W. University Drive, Suite 106 P.O. Box 1510 Tempe, Arizona 85281

Phone: (480) 921-8044 • Fax: (480) 921-0049

Lic. No. AZ0003

#### LABORATORY REPORT

Client: Oasis at Anozira

c/o Kinney Management Services

6303 S. Rural Road Tempe, Arizona 85283

Attn: Debbie Tribioli

Date Submitted: 05/06/20 Date Reported: 07/14/20

**Project:** Monthly Lake Monitoring

#### **RESULTS**

Client ID: Lake Sample Type: Surface Water ACT Lab No.: CC03761 Sample Time: 05/06/20 08:00

| Analysis Date           |              |          |                  |              |             |  |  |
|-------------------------|--------------|----------|------------------|--------------|-------------|--|--|
| Parameter               | <u>Start</u> | _End_    | Method No.       | Result       | <u>Unit</u> |  |  |
| Algae Count             | 06/30/20     | 06/30/20 | SM 10200 F       | See Attached | cells/mL    |  |  |
| Algae Identification    | 06/30/20     | 06/30/20 |                  | See Attached |             |  |  |
| Golden Algae            | 05/06/20     | 05/06/20 | P/C Microscopy   | Absent       | Pres/Abs    |  |  |
| Oxygen, Dissolved Field | 05/06/20     | 05/06/20 | SM4500 O G       | 6.8          | mg/L as O2  |  |  |
| pH, Field               | 05/06/20     | 05/06/20 | SM4500H+ B       | 8.3          | SU          |  |  |
| Temperature, Field      | 05/06/20     | 05/06/20 | SM2550 B         | 25.3         | С           |  |  |
| Nitrate + Nitrite - N   | 05/30/20     | 05/30/20 | SM4500NO3 E      | 0.08         | mg/L as N   |  |  |
| Phosphorus, Total       | 05/28/20     | 05/29/20 | 365.3            | 0.057        | mg/L as P   |  |  |
| Total Kjeldahl Nitrogen | 05/11/20     | 05/11/20 | SMNorg C,NH3 C/D | 1.4          | mg/L as N   |  |  |
| E. coli, Colilert       | 05/06/20     | 05/07/20 | SM 9223 B        | 15           | MPN/100 mL  |  |  |
| Turbidity               | 05/06/20     | 05/06/20 | 180.1            | 6.4          | NTU         |  |  |

Reviewed by:\_

**Laboratory Director** 

#### **ALGAE IDENTIFICATION**

| AC&T Lab No. | CC03761 | Date Collected | 05/06/20 |
|--------------|---------|----------------|----------|
| Client I.D.  | Oasis   | Collected By   | AC&T     |
|              |         |                | ·        |

Divisions: bac=Bacillariophyta; chl=Chlorophyta; cry=Chrysophyta; cyn=Cyanophyta; eug=Euglenophyta; hap=Haptophyta; pyr=Pyrrhophyta Forms: u=unicell; c=colony; f=filament; g= flagellate

|                    | Div    | Rel.  | Total  |        |                | Div    | Rel. | Total   |        |
|--------------------|--------|-------|--------|--------|----------------|--------|------|---------|--------|
| Genus              | Form   | Count | per mL | Comp.  | Genus          | Form   |      | per mL. | Comp   |
| Achnanthes         | bac-u  | 3     | 1786   | 1.85%  | Microcystis    | cyn-c  |      |         |        |
| Anabaena           | cyn-f  |       |        |        | Microspora     | chl-f  |      |         |        |
| Ankistrodesmus     | chl-u  |       |        |        | Mougeotia      | chl-f  |      |         |        |
| Aphanocapsa        | cyn-c  |       |        |        | Navicula       | bac-u  |      |         |        |
| Asterionella       | bac-c  |       |        |        | Nitzschia      | bac-u  |      |         |        |
| Botryococcus       | chl-c  |       |        |        | Oocystis       | chl-c  |      |         |        |
| Carteria           | chl-ug |       |        |        | Oscillatoria   | cyn-f  | 20   | 11908   | 12.35% |
| Cephalomonas       | chl-ug |       |        |        | Pandorina      | chl-cg |      |         |        |
| Characium          | chl-u  |       |        |        | Pediastrum     | chl-c  |      |         |        |
| Chlamydomonas      | chl-ug | 2     | 1191   | 1.23%  | Peridinium     | pyr-ug |      |         |        |
| Chlorella          | chl-u  | 45    | 26793  | 27.78% | Phacotus       | chl-ug |      |         |        |
| Chlorococcum       | chl-c  |       |        |        | Phacus         | chl-ug |      |         |        |
| Chroococcus        | cyn-c  | 12    | 7145   | 7.41%  | Pinnularia     | bac-u  |      |         |        |
| Chroomonas         | crp-ug | 1     | 595    | 0.62%  | Pithophora     | chl-f  |      |         |        |
| Closterium         | chl-u  |       |        |        | Prymnesium     | hap-ug |      |         |        |
| Cocconeis          | bac-u  |       |        |        | Rhizoclonium   | chl-f  |      |         |        |
| Coelastrum         | chl-c  |       |        |        | Rhoicosphenia  | bac-u  |      |         |        |
| Cosmarium          | chl-u  |       |        |        | Rhopalodia     | bac-u  |      |         |        |
| Cosmocladium       | chl-c  |       |        |        | Scenedesmus    | chl-c  | 21   | 12504   | 12.96% |
| Crucigenia         | chl-c  |       |        |        | Schroederia    | chl-u  | 1    | 595     | 0.62%  |
| Cyclotella         | bac-u  | 1     | 595    | 0.62%  | Selanastrum    | chi-u  | 3    | 1786    | 1.85%  |
| Cylindrospermopsis | cyn-f  |       |        |        | Sphaerocystis  | chl-c  |      |         |        |
| Cymbella           | bac-u  |       |        |        | Spondylumorum  | chl-c  |      |         |        |
| Diatoma            | bac-u  | 1     | 595    | 0.62%  | Spirulina      | cyn-f  | 28   | 16671   | 17.28% |
| Dinobryon          | bac-c  |       |        |        | Stauroneis     | bac-u  |      |         |        |
| Dunaliella         | chl-u  |       |        |        | Stephanodiscus | bac-u  |      |         |        |
| Epithemia          | bac-u  |       |        |        | Stigeoclonium  | chl-f  |      |         |        |
| Euglena            | eug-ug |       |        |        | Surirella      | bac-u  |      |         |        |
| Fragilaria         | bac-u  | 20    | 11908  | 12.35% | Synechococcus  | cyn-u  |      |         |        |
| Frustulia          | bac-u  |       |        |        | Synechocystis  | cyn-c  |      |         |        |
| Glenodinium        | pyr-ug |       |        |        | Synedra        | bac-u  | 2    | 1191    | 1.23%  |
| Golenkinia         | chl-c  |       |        |        | Synura         | cry-cg |      |         |        |
| Gomphonema         | bac-u  | 1     | 595    | 0.62%  | Tetraedron     | chl-u  | 1    | 595     | 0.62%  |
| Gonium             | chl-cg |       |        |        | Tetrastrum     | chl-c  |      |         |        |
| Gonyaulax          | pyr-ug |       |        |        | Trachelomonas  | eug-ug |      |         |        |
| Gyrosigma          | bac-u  |       |        |        | Vaucheria      | chl-f  |      |         |        |
| Hydrodictyon       | chl-c  |       |        |        | Volvox         | chl-cg |      |         |        |
| Lyngbya            | cyn-f  |       |        |        | Zygnema        | chl-f  |      |         |        |
| Melosira           | bac-f  |       |        |        |                | 1      |      |         |        |
| Meridion           | bac-u  |       |        |        |                |        |      |         |        |
| Merismopedia       | cyn-c  |       |        |        |                |        |      |         |        |

check 100.00%

Aquatic Consulting & Testing, Inc. 1525 W. University Dr., Suite 106 Tempe, Arizona 85281

| Count (cells/mL) | 9.65E+04 |
|------------------|----------|
|                  |          |

#### **Laboratory Sample** Identification 19150-22 AC&T Page1 of 1 Monthly Lake Monitoring 3. RELINQUISHED BY: Oasis at Anozira 4. RECEIVED BY: Cther: Siogna Sample Containers # / Preservation: Client Project Info: H2SO4 (Sulfuric) HNO3 (Nitric) Na2S2O3 (Sterile) N Print Name: Print Name: Signature: Signature: PH, Temp, O2 × Field Measurements: Golden Algae Algae Count & ID × 330 **Chain of Custody** 1. RELINQUISHED BY: Turbidity × 2. RECEIVED BY: myster Total E.Coli -MPN × Total Kjeldahl Mitrogen (TKM) × Print Name: Print Name: Signature: Total Phosphorous (P-T) × Signature: × **NO3+NO5** WET BLUE YES NO 0 9 42 SW A C & T Sample Receipt: Matrix: YES (F) Aquatic Consulting & Testing, Inc. AC&T Client Reporting Information: 8.8 Time: Sample Receipt Temperature: **Fotal # Containers** Samples Intact: Samples On Ice: **Custody Seals:** ice Type: c/o Kinney Management Services 2.6.20 (480) 921-8044 Fax (480) 921-0049 Date: Man 1525 W. University Dr. Ste. #106 E: debbie@kinneymanagement.com 6303 South Rural Road Attn: Debbie Tribioli Tempe, Arizona 85281 Tempe, AAZ 85283 AC&T Sampler Oasis at Anozira Project Location: Sample Location ID: & Oasis at Anozira P: 480-820-3451 7 sag Lake Contract Lake ₩ ₩



#### AQUATIC CONSULTING & TESTING, INC.

1525 W. University Drive, Suite 106 P.O. Box 1510 Tempe, Arizona 85281

Phone: (480) 921-8044 • Fax: (480) 921-0049

Lic. No. AZ0003

#### **GOLDEN ALGAE REPORT**

Client: Oasis at Anozira c/o Kinney Management Services 6303 S. Rural Road Tempe, Arizona 85283

Attn: Debbie Tribioli

Date Submitted: 05/13/20 Date Reported: 05/14/20

Project: Golden Algae Screen

#### **RESULTS**

Client ID: Lake Sample Type: Surface Water ACT Lab No.: CC03995 Sample Time: 05/13/20 12:00

**Analysis Date** 

<u>Parameter</u> Start End Method No. MDL Result Unit **Analyst** Golden Algae 05/13/20 05/13/20 P/C Microscopy 1 Present 2 Pres/Abs MEW

#### **Explanation of Terms:**

Absent = No golden algae\* were detected in the submitted sample.

<u>Present 1</u> = Golden algae\* were detected, but rarely observed in the submitted sample.

<u>Present 2</u> = Golden algae\* were detected and commonly observed in the submitted sample.

Present 3 = Golden algae\* were detected and were the dominant algae in the submitted sample.

lea

Reviewed by:

Frederick A. Amalfi, Laboratory Director

<sup>\*</sup>Prymnesium parvum or toxin producing related species.

#### **Laboratory Sample** CC-03995 Identification ACST Page 1 of 1 Golden Algae Screen Oasis at Anozira 3. RELINQUISHED BY: 4. RECEIVED BY: sjobn-Sample Containers # / Preservation: Client Project Info: 42SO4 (Sulfuric) HNO3 (NIFLIC) (elinet2 ) £OSSS&N Print Name: Print Name: Non Preserved Signature: Signature: SO, qmaT, Hq Field Measurements: Golden Algae × Algae Count & ID 1435 Chain of Custody 1. RELINQUISHED BY: Turbidity 2. RECEIVED BY: Time: Total E.Coli -MPN 8-12-5 Signature: My Total Kjeldahl Mitrogen (TKM) Print Name: Print Name: (T-q) suorondgodd IstoT WET | BLUE | Signature: NO3+NO2 234. YES O NES NO YES M SW A C & T Sample Receipt: Aquatic Consulting & Testing, Inc. AC&T Client Reporting Information: 5-13,20 1200 Total # Containers: Sample Receipt Temperature: Samples On Ice: Samples Intact: Custody Seals: Ice Type: c/o Kinney Management Services 202 (480) 921-8044 Fax (480) 921-0049 Date: 1525 W. University Dr. Ste. #106 E: debbie@kinneymanagement.pom 6303 South Rural Road Attn: Debbie Tribioli Tempe, Arizona 85281 Tempe, AAZ 85283 AC&T Sampler, Oasis at Anozira Project Location: Sample Location ID: Golden Algae Seasonal Monitoring (Oct - May) P: 480-820-3451 Oasis at Anozira Lake Contract Lake #0d



#### AQUATIC CONSULTING & TESTING, INC.

1525 W. University Drive, Suite 106 P.O. Box 1510 Tempe, Arizona 85281

Phone: (480) 921-8044 • Fax: (480) 921-0049

Lic. No. AZ0003

#### **GOLDEN ALGAE REPORT**

Client: Oasis at Anozira

c/o Kinney Management Services

6303 S. Rural Road

Tempe, Arizona 85283

Attn: Debbie Tribioli

Date Submitted: 05/20/20 Date Reported: 05/26/20

Project: Golden Algae Screen

#### **RESULTS**

Client ID: Lake Sample Type: Surface Water
ACT Lab No.: CC04166 Sample Time: 05/20/20 12:20

**Analysis Date** 

ParameterStartEndMethod No.MDLResultUnitAnalystGolden Algae05/20/2005/20/20P/C Microscopy1Present 1Pres/AbsDC

#### **Explanation of Terms:**

Absent = No golden algae\* were detected in the submitted sample.

<u>Present 1</u> = Golden algae\* were detected, but rarely observed in the submitted sample.

Present 2 = Golden algae\* were detected and commonly observed in the submitted sample.

<u>Present 3</u> = Golden algae\* were detected and were the dominant algae in the submitted sample.

lea

Reviewed by:

Frederick A. Amalfi, Ph. Laboratory Director

<sup>\*</sup>Prymnesium parvum or toxin producing related species.

#### **Laboratory Sample** Identification CC-04166 AC&T Page1, of 1 Golden Algae Screen Oasis at Anozira 3. RELINQUISHED BY: 4. RECEIVED BY: Other: sjoßną Sample Containers # / Preservation: Client Project Info: 12SO4 (Sulfuric) HNO3 ( Nitric) Na2S2O3 (Sterile) Print Name: Print Name: Signature: Signature: Date: pH, Temp, O2 Field Measurements: Solden Algae × Algae Count & ID 13005 **Chain of Custody** 1. RELINQUISHED BY Turbidity 2. RECEIVED BY: Total E.Coli -MPN 5120120 Total Kjeldahl Nitrogen (TKN) WET BLUE Signature: No. Print Name: Print Name: Total Phosphorous (P-T) Signature **403+400** (OK (3) ջ 2500 SW A C & T Sample Receipt: Matrix: YES YES **(E)** Aquatic Consulting & Testing, Inc. AC&T Client Reporting Information: Time: Total # Containers Sample Receipt Temperature: Samples On Ice: Custody Seals: Samples Intact: fce Type: c/o Kinney Management Services Bu (480) 921-8044 Fax (480) 921-0049 Date: 1525 W. University Dr. Ste. #106 E: debbie@kinneymanagement.com 6303 South Rural Road Attn: Debbie Tribioli AC&T Sampler: Tempe, Arizona 85281 Tempe, AAZ 85283 Oasis at Anozira Project Location: Sample Location ID: Golden Algae Seasonal Monitoring (Oct - May) P: 480-820-3451 Oasis at Anozira Lake Contract Lake ₩ #



#### AQUATIC CONSULTING & TESTING, INC.

1525 W. University Drive, Suite 106 P.O. Box 1510 Tempe, Arizona 85281

Phone: (480) 921-8044 • Fax: (480) 921-0049

Lic. No. AZ0003

#### **GOLDEN ALGAE REPORT**

Client: Oasis at Anozira

c/o Kinney Management Services

6303 S. Rural Road

Tempe, Arizona 85283

Attn: Debbie Tribioli

Date Submitted: 05/27/20

Date Reported: 06/01/20

Project: Golden Algae Screen

#### **RESULTS**

Client ID: Lake Sample Type: Surface Water ACT Lab No.: CC04310 Sample Time: 05/27/20 12:00

**Analysis Date** 

Parameter Start Method No. MDL End Result Unit **Analyst** Golden Algae 05/27/20 05/27/20 P/C Microscopy 1 **Absent** FAA Pres/Abs

#### **Explanation of Terms:**

Absent = No golden algae\* were detected in the submitted sample.

<u>Present 1</u> = Golden algae\* were detected, but rarely observed in the submitted sample.

<u>Present 2</u> = Golden algae\* were detected and commonly observed in the submitted sample.

Present 3 = Golden algae\* were detected and were the dominant algae in the submitted sample.

Reviewed by:

Frederick A. Amalfi, Ph.9 **Laboratory Director** 

<sup>\*</sup>Prymnesium parvum or toxin producing related species.

| 1525 W. University Dr. Ste. #106  | . Ste. #106                              |          | i vy                             |                               | 1                 |                 |                  |   | Clien         | Client Project Info:        | t Info                                 |               |   |
|---|--|----------|----------------------------------|-------------------------------|-------------------|-----------------|------------------|---|---------------|-----------------------------|--|---------------|---|
| Tempe, Arizona 85281<br>(480) 921-8044 Fax (480) 921-0049   | 80) 921-0049                             | _        |                                  |                               | Chain of          | Custody         |                  |   |               |                             | 9                                      | olden<br>Oası | Golden Algae Screen<br>Oasis at Anozira |
| AC&T Client Rep   | AC&T Client Reporting Information:       |          |                                  |                               |                   |                 |                  |   | 1             | Sample<br>#/Pre             | Sample Containers<br># / Preservation: | £             | Page 1 of 1                             |
| Oasis at Anozira c/o Kinney Management Services Attn: Debbie Tribioli 6303 South Rural Road Tempe, AAZ 85283 P: 480-820-3451 E: debbie@kinneymanagement.com AC&T Sampler: Sample Location ID: | nent Services i oad hent.com funty Time: | Matrix:  | VO3+NO2  Total Phosphorous (P-T) | Total Kjeldahl Nitrogen (TKN) | Total E.Coli -MPN | VibidiuT        | Algae Count & ID | Golden Algae<br>Field Measurements:<br>PH, Temp, O2 | bevreserd nov | NaSSOS ( Sterile) (Alteric) | HSSO4 ( Sulfuric)                      | Lugols        | Labora                                  |
| Lake  | कर। व्यारोड                              | SW       |                                  |                               |                   |                 |                  | ×   | -             |                             |  |               | CC-04310                                |
|   |  |          |                                  |                               |                   |                 |                  |   |               |                             |  |               |   |
|   |  |          |                                  |                               |                   |                 |                  |   |               |                             |  |               |   |
|   |  |          |                                  |                               |                   |                 |                  |   |               |                             |  | u s           |   |
|   |  |          |                                  |                               |                   |                 |                  |   |               |                             |  |               |   |
|   |  |          |                                  |                               |                   |                 |                  |   |               |                             |  |               |   |
| Project Location:   | A C & T Sample Receipt:                  | Receipt: |                                  | Na Sal                        | 1. RELINQUISHED   | UISHED BY:      | " "              |   |               | 100                         | 9.                                     | RELING        | RELINQUISHED BY:                        |
| Oasis at Anozira  | Total # Containers:                      | -        | Signature                        | 9                             | 0                 | Mm              | Me               | Sign  | Signature:    |                             |  |               |   |
| PO#:  | Custody Seals:                           | YES (Ø)  | Print Name:                      | A in                          | dren              | Mun             | Mar              | Prin  | Print Name:   |                             |  |               |   |
| Lake Contract   | Samples Intact:                          | ON (B)   | Date: 5                          | 177                           | 30                | Time: (322)     | - (              | Date:   |               |                             |  |               | Time:                                   |
| Notes;  | Samples On Ice:                          | YES NO   |                                  | `                             | 2. RECE           | 2. RECEIVED BY: | W D              |   |               |                             |  | 4. RECE       | 4. RECEIVED BY:                         |
| Golden Algae<br>Saasonal Monitoring   | Ice Type:                                | WET BLUE | Signature:                       | 7                             |                   |                 |                  | Sign  | Signature:    |                             |  |               |   |
| ct - May)   | Sample Receipt                           | 24.6     | Print Name:                      | 9: PAS                        |                   |                 |                  | Prin  | Print Name:   |                             |  |               |   |

- 8

### OASIS AT ANOZIRA FIELD INSPECTION FORM

| Date: 5/6/20<br>By: 4/10  |                            | :/lists&forms)  | XIVI (          |
|---|----------------------------|-----------------|-----------------|
| Aeration System O   |                            | Lake Surf       | face            |
| operational   | roblem                     | □ Lake su       | urface cleaning |
| Details:  |                            |                 |                 |
| ÷   |                            |                 |                 |
|   | □ West ☑ East ☑ South      |                 |                 |
| □ operational □ Pr  | oblem Details:             |                 |                 |
| Pump house  | housekeeping 🗆 leaks       | □ ventilation □ | lighting Notes  |
| Compressors   | □ operational □ Problem    | Details:        |                 |
| Pumps   | □ operational □ Problem    | Details:        |                 |
| Entry Fountains  Elliot North: pe   | rational   Screens cleared |                 | 1               |
|   | rational Screens cleared   |                 |                 |
| Los Feliz: ope  | rational Screens cleared   | □ Problem De    | etails:         |
| Monthly Chemistry   | & Biology                  |                 |                 |
| Dissolved oxygen Temperature pH Algae ID and count Ammonia-N Organic N (TKN) Phosphorus Turbidity E. coli | 6.8<br>3533<br>W           | E               |                 |
| □/Golden algae (seas  | sonal)                     |                 |                 |

## OASIS AT ANOZIRA FIELD INSPECTION FORM (

| Date: 5/13/20<br>By:   | wpdoc/lists&d                       | forms)                              |
|--|-------------------------------------|-------------------------------------|
| Aeration System O  |                                     | Lake Surface                        |
| perational D   | roblem                              | □ Lake surface cleaning             |
| Details:   | b Dead Fish most                    | ly carp                             |
| Floating Fountains   | West East South                     |                                     |
| operational operational  | roblem Details:                     |                                     |
| Pump house   | d housekeeping □ leaks □ ve         | entilation   lighting Notes         |
| Compressors  | □ operational □ Problem Def         | ails:                               |
| Pumps  | operational operational operational | ails:                               |
| Entry Fountains  |                                     | . 11 1 /                            |
| Elliot North: pope   | erational   Screens cleared         | Problem Details: Hydrothol phyconyc |
| Elliot South: ope  | erational Screens cleared           | Problem Details:                    |
| Los Feliz: ope   | erational Screens cleared           | Problem Details:                    |
| <b>Monthly Chemistry</b>   | & Biology                           |                                     |
| Dissolved oxygen Temperature pH Algae ID and coun Ammonia-N Organic N (TKN) Phosphorus Turbidity E. coli Golden algae (sea | W S                                 |                                     |

### OASIS AT ANOZIRA FIELD INSPECTION FORM

|   | LIELD INSPI               | ECTION FOR    | EIVI (            |
|---|---------------------------|---------------|-------------------|
| Date: 5 20 20<br>By: 4  | wpdoc<br>                 | /lists&forms) |                   |
| Aeration System Op  | eration                   | Lake Surf     | face              |
| perational pro  | blem                      | □ Lake su     | ırface cleaning   |
| Details:  |                           |               |                   |
|   |                           |               |                   |
| Floating Fountains  | West Rast South           |               |                   |
| □_operational □ Pro   | oblem Details:            |               |                   |
|   |                           |               | lighting Notes    |
| Compressors   | □ operational □ Problem   | Details:      |                   |
| Pumps   | operational   Problem     | Details:      |                   |
| Entry Fountains  Elliot North: per  | ational 🗗 Screens cleared | □ Problem De  | etails: Hydrothol |
|   | ational d Screens cleared |               |                   |
| Los Feliz: opera  | ational Screens cleared   | □ Problem De  | etails:           |
| Monthly Chemistry &  Dissolved oxygen  Temperature  pH  Algae ID and count Ammonia-N  Organic N (TKN) | 1/. l<br>27. g            | B B           |                   |
| <ul><li>□ Phosphorus</li><li>□ Turbidity</li><li>□ E. coli</li><li>□ Golden algae (seas)</li></ul>    | onal)                     |               |                   |

## OASIS AT ANOZIRA FIELD INSPECTION FORM

| Date: 5/27/2  |                              | ECTION FORM ( :/lists&forms)   |   |
|---|------------------------------|--|---|
| Aeration System   |                              | Lake Surface   |   |
| operational   | Problem                      | □ Lake surface cleaning  |   |
| Details:  |                              |  |   |
|   |                              |  |   |
| Floating Fountair   | ns - West 1 East 1 South     |  |   |
| □ coperational □  | Problem Details:             |  |   |
| Pump house  |                              | □ ventilation □ lighting Notes   |   |
| Compressors   | □ operational □ Problem      | Details:   |   |
| Pumps   | ☑ operational □ Problem      | Details:   |   |
| Entry Fountains  Elliot North:  |                              | □ Problem Details: Hydrath8  |   |
|   | /                            | □ Problem Details:   |   |
| Los Feliz:  | perational   Screens cleared | □ Problem Details:   | _ |
| Monthly Chemistr  Dissolved oxyge Temperature pH Algae ID and col Ammonia-N Organic N (TKN) | unt W. 4                     |  |   |
| □ Phosphorus  | ,                            | The second of th |   |

□ Turbidity

□ E. coli
fi Golden algae (seasonal)



## AQUATIC CONSULTING & TESTING, INC. 1525 West University Drive, Suite 106

Tempe, Arizona 85281

Phone: 480-921-8044 Fax 480-921-0049

#### PESTICIDE TREATMENT NOTICE & RECORD

Client: The Oasis at Anozira

Attn: Debbie Tribioli

The Oasis at Anozira

C/O Kinney Management Services

6303 South Rural Road

Tempe, Az 85283

Location: Entry features (May 2020)

| Date: 05-06-20 | Time: 09:00 | Conditions: X clear | pt cloudy | overcast |
|----------------|-------------|---------------------|-----------|----------|
| 05-13-20       |             | cold                | X mild    | mild     |
| 05-20-20       |             |                     |           |          |
| 05-27-20       |             |                     |           |          |

| Material:    | Reg. No. (*restricted) | Tot. Qty:            | Acres/Volume: |
|--------------|------------------------|----------------------|---------------|
| Hydrothol    | 4581-174               | 2.2 pt               | 0.03 Aft      |
|              |                        |                      |               |
| Target Pest: | _lalgae                | Degree of infestatio | n: low        |

Application method/calculations:

 $2.25 \text{ G/Aft} \times 0.03 \text{ Aft} = 0.0675 \text{ Gal } (0.54 \text{ pt}) \times 4 \text{ apps} = 2.2 \text{ pt}$ 

Dosage/rate 1.5 ppm Percent active ingredient: 53% endothol

Applicator: Murrett Cert. No. 061093

Remarks/follow-up: algae

#### Precautionary Statement:

Warning-Pesticides can be harmful. Keep children and pets away from pesticide applications until dry, dissipated, or aerated. For more information contact Aquatic Consulting & Testing, Inc. at 480-921-8044 and ask for Dr. Rick Amalfi. AC&T License No. 4418 F. A. Amalfi QP#1360 Cert. No. 900496



## AQUATIC CONSULTING & TESTING, INC. 1525 West University Drive, Suite 106 Tempe, Arizona 85281

Phone: 480-921-8044 Fax 480-921-0049

#### PESTICIDE TREATMENT NOTICE & RECORD

Client: The Oasis at Anozira

Attn: Debbie Tribioli

The Oasis at Anozira

C/O Kinney Management Services

6303 South Rural Road

Tempe, Az 85283

Location: Entry features (May 2020)

| Date: 05-06-20 | Time: 09:00 | Conditions: X clear | pt cloudy     | overcast |
|----------------|-------------|---------------------|---------------|----------|
| 05-13-20       |             | cold                | X <u>mild</u> | mild     |
| 05-20-20       |             |                     |               |          |
| 05-27-20       |             |                     |               |          |

| Material: | Reg. No. (*restricted) | Tot. Qty: | Acres/Volume: |
|-----------|------------------------|-----------|---------------|
| Hydrothol | 4581-174               | 2 qt      | 0.03 Aft      |
|           |                        |           |               |

Target Pest: algae Degree of infestation: low

#### Application method/calculations:

5.0 G/Aft x 0.03 Aft = 0.15 Gal (1..2 pt) x 3 features  $\approx$  2 qt per week

Dosage/rate 3.0 ppm Percent active ingredient: 53% endothol

Applicator: Murrett Cert. No. 061093

Remarks/follow-up: algae

#### Precautionary Statement:

Warning-Pesticides can be harmful. Keep children and pets away from pesticide applications until dry, dissipated, or aerated. For more information contact Aquatic Consulting & Testing, Inc. at 480-921-8044 and ask for Dr. Rick Amalfi. AC&T License No. 4418 F. A. Amalfi QP#1360 Cert. No. 900496